



ENVIRONMENTAL
TECHNOLOGIES

20-11242



OMEGA'S NEW "ENHANCED" HS110R

Honda CRV Scroll compressors Failing


A/C Compressors for the 2002-2006 Honda CRV are historically failing in the 40,000 mile range according to Honda users in the Edmunds Carspace Forum (link below). Repairs by dealers has proven to be ineffective, in fact Honda has not yet acknowledged this as a problem and has no plans to correct this issue. (YOU CAN CLICK ON THE LINK BELOW IN PDF)

[Http://townhall.edmunds.com/direct/view/.f0d3fb5/1317](http://townhall.edmunds.com/direct/view/.f0d3fb5/1317)

Omega has a solution for this Catastrophic Failure.

When a Honda CRV scroll compressor has a CATASTROPHIC failure, debris from the failed compressor contaminates the complete air conditioner system. Merely changing the compressor is a short term fix and contamination from the system that can't be properly flushed, will be returned or transmitted back to the compressor. The result is a second CATASTROPHIC compressor failure.

Omega's new "ENHANCED" 20-11242 HS110R compressor (picture 1) includes a factory installed filter screen in the suction line (picture 2), essentially eliminating this reoccurring problem in the 02-06 Honda CRV a/c compressor.

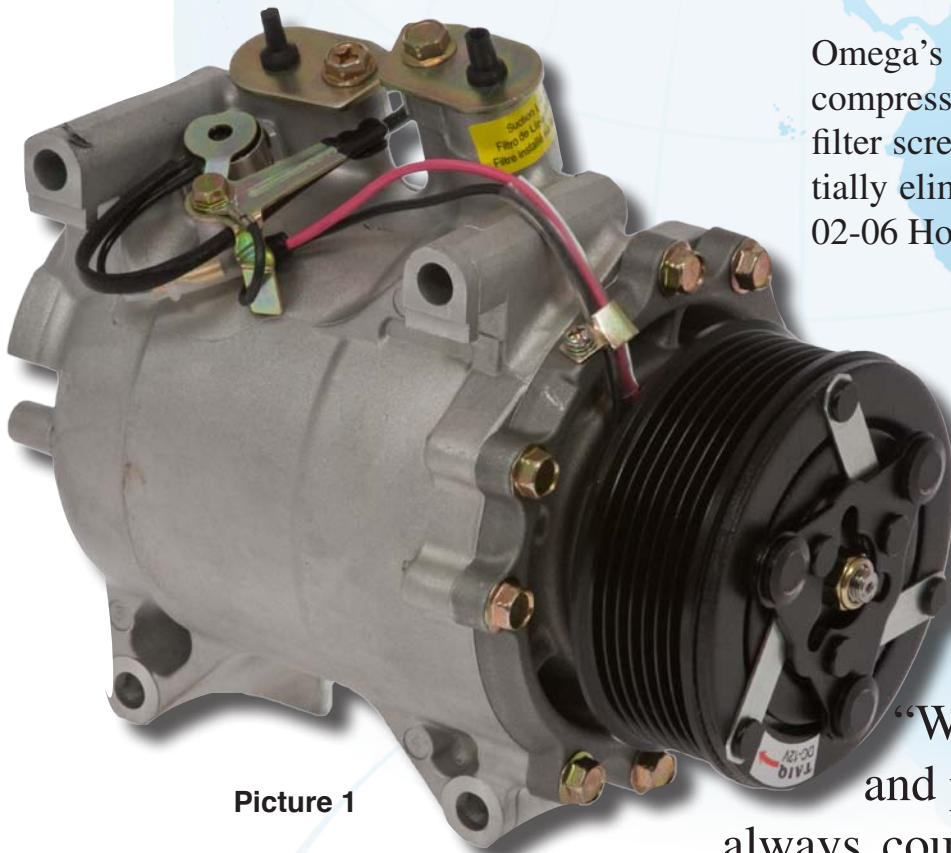

Picture 1



Picture 2

"When it comes to innovation and problem solving, you can always count on Omega Environmental Technologies"

Omega Environmental Technologies • 1401 Valley View Lane, Suite 100 • Irving, Texas 75061

Main: 972.812.7000 • Fax 972-314-9567 • Toll Free Phone: 888.286.6342

www.omega-usa.com